




OPERATING INSTRUCTIONS FOR THE LCD ENVIRONMENTAL TEMPERATURE RECORDER

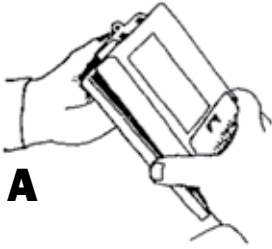


A

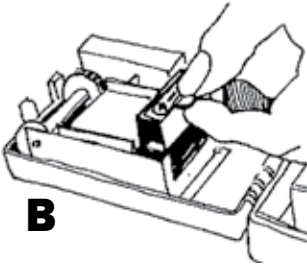


B

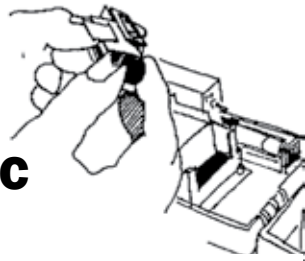


C

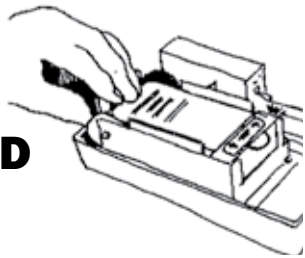

D

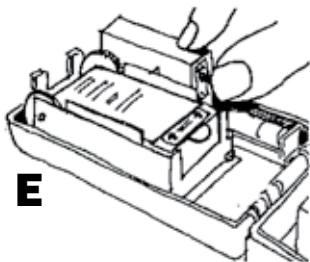

E

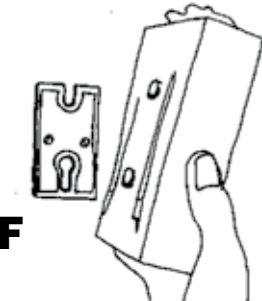

F

To Install Chart:

1. Remove the DeltaTRAK LCD Environmental Temperature Recorder from its shipping box.
2. To open the recorder, press the horizontal latch below the hanger hole located on the top of the instrument, as illustrated in Diagram A.
3. Lay the recorder on a flat surface.
4. Lift the chart box from its holder, as illustrated in Diagram B.
5. Insert the chart into the box by sliding it through the open end so that the "ATTACH TO SPOOL" label and the chart pulls through the open slot, as illustrated in Diagram C.
6. Slide the box back into its holder, making sure that the arrows on the box point towards the spool.
7. Carefully, peel off the back of the "ATTACH TO SPOOL" label; pull the chart towards the spool and attach the chart to the spool, as illustrated in Diagram D.
8. Fill out the information section on the new chart.
9. Advance the chart so that the arrows on the chart and the red arrow on the writing platform are aligned.
10. Move the ON-OFF switch to the "ON" position, as illustrated in Diagram E. The LCD on the top of the case will then display the current environmental temperature.
11. To verify the unit is operational, check side viewing port and observe the gear movement.
12. Close the recorder, pressing firmly to ensure the latch engages tightly. If desired, the recorder can be locked by sliding a security cable through the latch.

MOUNTING INSTRUCTIONS

To Mount on Solid Surface:

1. Attach wall mounting bracket to desired surface using wood screws, nuts and bolts, or industrial adhesive tape, as illustrated in Diagram F.
2. Align the raised pegs on the back of recorder with the holes in the wall mount bracket.
3. Gently slide the recorder down to secure it in place.

To Hang:

1. Pull a thin wire or chain through the hanger hole at the top of the recorder. Hang at desired level and secure in place.

To Remove Completed Chart:

1. Remove the recorder from the mounting bracket and press latch to open.
2. Grasp the end of the completed chart; gently pull the chart from the spool a little at a time and rewind. Continue until the chart is complete off the spool.
3. Retain chart for your records.
4. Replace with a new chart according to the directions above.

Reading the DeltaTRAK LCD Environmental Temperature Recorder:

The DeltaTRAK LCD Environmental Temperature Recorder produces a continuous strip chart temperature recording of environmental conditions. In addition, an LCD display provides continuous visible access of the current environmental conditions.

Note: This unit is factory calibrated. Re-calibration by user will void the factory warranty.



DeltaTRAK®

800-962-6776

P.O. Box 398 • Pleasanton, CA 94566

Tel: 925-249-2250 • Fax: 925-249-2251

Email: salesinfo@deltatrak.com • www.deltatrak.com